


TXT 4.0 Controller Troubleshooting - no connection with ROBO Pro Coding possible, and “txtapi” is displayed

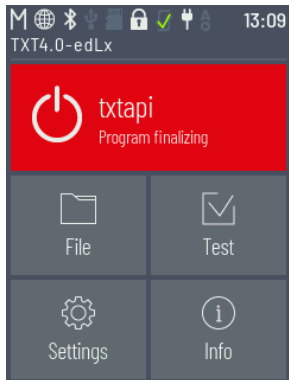

If the TXT 4.0 Controller displays the red button labeled “txtapi” approx one minute after it is switched on for the first time, then a connection cannot be formed with ROBO Pro Coding.



This error can be corrected as described in this document. The software on the TXT 4.0 Controller will be replaced.

Please complete the following steps:

1. To complete an update, the TXT 4.0 Controller must be connected to the internet via Wi-Fi. To do so, select an internet router for the appropriate SSID / Wi-Fi network in Settings / Network / Wi-Fi.

Whether the Controller is connected to the internet is displayed in the status line. The device is connected to the internet if the globe symbol is displayed instead of the WiFi symbol.

2. Select the latest version in Setting / Updates/ Online Updates / Online Updates: and Release 3.1.0, then press “Installation.” The installation will be completed. This process will take several minutes.
3. Afterward, the Controller must be switched off and back on again manually. Please ensure that the Controller boots up and remains switched on for approx. one minute.

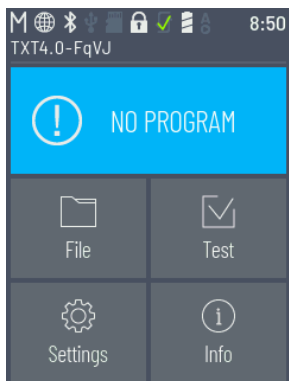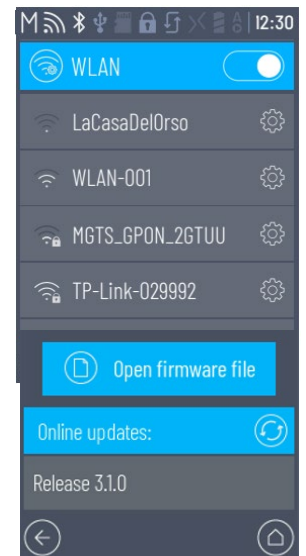

If “NO PROGRAM is displayed after this process is complete, then the error was successfully corrected, and the Controller can be connected to ROBO Pro Coding once again.